

MODEL 85 **ultrastable**

316L SS Pressure Sensor

High Performance, Small Profile

0-100 mV Output


Absolute and Gage

Low Pressure

DESCRIPTION

This is a micromachined piezoresistive silicon pressure sensor. It is designed for OEM applications where compatibility with corrosive media must be maintained. The sensor chip is mounted on a TO style header, which is resistance welded to a 316 stainless steel package. A 316 stainless steel convoluted isolation diaphragm is welded to the package, sealing a small volume of silicon oil between the diaphragm and the sensor chip. The

ISO pressure housing utilizes the oil column to couple the piezoresistive sensor to the isolation diaphragm. A thickfilm ceramic compensation board with laser trimmed resistors, and an additional gain set resistor to normalize pressure sensitivity are an integral part of the sensor package. A variety of threaded process fittings are available. Fittings include standards like 1/4 and 1/8 NPT, 1/4 BSP as well as custom process fittings. Electrical options include cable and connector.

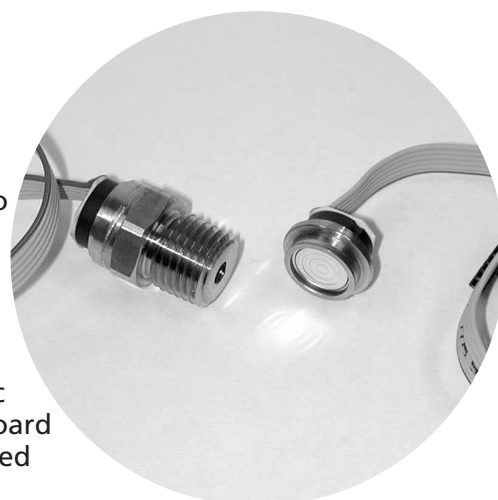


FEATURES

- ◆ Weldable and O-ring Flush Mount
- ◆ -20°C to 85°C Compensated Temperature Range
- ◆ $\pm 0.1\%$ Pressure Non-linearity
- ◆ $\pm 1.0\%$ Interchangeable Span (provided by gain set resistor)
- ◆ Solid State Reliability
- ◆ Low Power

APPLICATIONS

- ◆ Medical Instruments
- ◆ Process Control
- ◆ Oceanography
- ◆ Refrigeration/Compressors
- ◆ Pressure Transmitters
- ◆ Level Systems

Dimensions

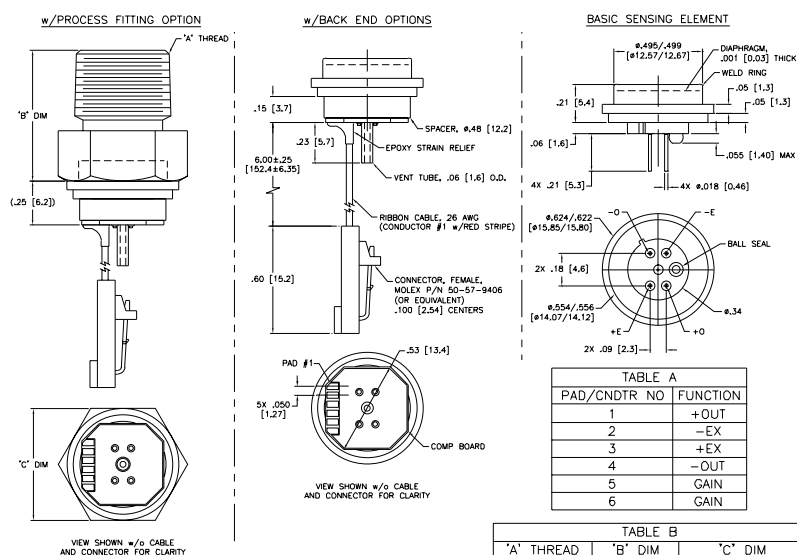

internet:www.msensors.com

Tel: 1-757-766-1500

North America Toll Free: 1-800-745-8008

Fax: 1-757-766-4297

7/16/04

msensors
innovation • performance • reliability

Schaevitz
IC Sensors
Microfused
Piezo Film

MODEL 85 **ultrastable**

Performance Specifications

All parameters measured at 1.5mA drive and at 25°C after 10 second warm up, unless otherwise specified. Unless specifically indicated, only those parameters indicated as tested are verified on each part. Parameters are specified for the compensated version only.

PARAMETERS	MIN	TYP	MAX	UNITS	NOTES
Full Scale Output Span	75	100	150	mV	1.2
Zero Offset	-1	0	1	mV	2
Pressure Non-linearity	-0.10		0.10	% Span	3
Pressure Hysteresis	-0.5	0.02	0.05	% Span	
Input Resistance	2000	3500	4500	Ω	
Output Resistance	4000		25000	Ω	
Temperature Error - Span	-0.75		0.75	% Span	4
Temperature Error - Zero	-0.5		0.5	% Span	4, 5
Thermal Hysteresis - Span		0.05		% Span	4
Thermal Hysteresis - Zero		0.05		% Span	4
Long Term Stability of Offset		0.1		±% Span/yr.	
Long Term Stability of Span		0.1		±% Span/yr.	
Supply Current	0.5	1.5	2.0	mA	6
Output Load Resistance	5			MΩ	7
Insulation Resistance (50 VDC)	50			MΩ	8
Pressure Overload			3X	Rated	
Compensated Operating Temperature	-20°C to 85°C				9
Operating Temperature Range	-40°C to +125°C				9
Storage Temperature Range	-50°C to +125°C				9
Media - Pressure Port	Liquids and Gases compatible with 316L Stainless Steel				
Media - Reference Port	Compatible with Silicon, Pyrex, Gold, Fluorosilicon Rubber and 316L Stainless Steel				
Weight	13 grams				10

Notes

1. For amplified output circuits, 3.012V ± 1% interchangeability with gain set resistor. See Application Note TN-003.
2. Measured at vacuum for absolute (A), ambient for gage (G).
3. Best fit straight line.
4. Over Temperature range: -20°C to +85°C Span with respect to +25°C.
5. 15 psi range sensors have a temperature error of ±0.75% (Max) of Zero from -20°C to 85°C.
6. Guarantees output/input ratiometricity.
7. Load resistance to reduce measurement errors due to output loading.
8. Between case and sensing element.
9. Maximum temperature range for product with standard cable and connector is -20°C to +105°C.
10. Weight depends upon configuration (cable, connector, pressure fitting).
11. For gage units used at pressures below atmosphere, the span accuracy is not guaranteed.
12. Standard gauge units are not recommended for vacuum applications. For vacuum applications below 1/2 atmosphere, contact factory.

Standard Ranges

Range	psig	psia
0 to 15	•	•
0 to 30	•	•
0 to 50	•	•
0 to 100	•	•
0 to 300	•	•
0 to 500	•	•

Connections

Rad. No./Cable	Function
1	+OUT
2	-EX
3	+EX
4	-OUT
5	GAIN
6	GAIN

Ordering Information

85 - 050 G - 0 C T

Vent (T = Tube, Blank is standard = No Tube)

Electrical (C = Ribbon Cable with Connector, P = Solder Pads, R = Ribbon Cable, L = Leads, Uncompensated)

Pressure Port (0 = Weldable, No Thread, 4 = 1/4 - 18 NPT, 5 = 1/4 - 19 BS, 8 = 1/8 - 27 NPT)

Type (A=Absolute, G=Gage)

Pressure Range (15 to 500 psi, 050 = 50 psi)

Model

Application Schematic

